# PORTLAND PUBLIC SCHOOLS - FACILITY ADA ASSESSMENT

Hosford 6-8 August 31, 2009

Site Accessibility

Parking/Entry	If the two at-grade doors to the cafeteria will be used for ADA entry in addition to the main east entry doors noted, then provide striping to that door from the ADA parking similar to above. Also, if this entry will be used for ADA access, the trash bins should be screened from the route.	
Exterior Ramp to Play Area	See Elevator below for proposal to leave the non-compliant ramp in place and add another.	
Entry, North Basement	Repair the existing sidewalk to the perimeter public way sidewalk to be an accessible route.	
Entry, South Basement	Provide an accessible ramp from the pavement to the west entry doors to provide an accessible ramp.	

### Accessible Route & Features

Elevator	Provide an elevator for access to the second
Stairs	floor. One possible location for the elevator
Exterior Ramp	would be at the passageway between the main
	building and the cafeteria since a lift at that
	location would be needed for full access
	otherwise. As part of the renovation, the
	existing main floor stair would need to be
	replaced with an accessible stair and handrails
	east of the elevator. The entry doors to the
	north parking lot could be replaced with an
	accessible door if desirable. An accessible
	door to the west play area could be provided at

	the south side of the passageway, connecting	
	to a new sidewalk or ramp with handrails to	
	the play area.	
Library 129/	Provide lever handles on double doors.	
Media Center	Trovide level flandles on double doors.	
Cafeteria 16	Poplace pair of dears with accessible dear and	
Calelena 10	Replace pair of doors with accessible door and hardware.	
Office 121	Provide lever handles on door.	
Gymnasium 113	Replace the northeast set of doors and	
Gymnasium 115	· ·	
	hardware to provide at least one leaf with 32- inch clear access and lever and/or push bar	
	hardware. Replacing more than one set of	
	doors is preferable for egress in case	
	evacuation is not possible through one set of	
	doors.	
Auditorium 112	Provide lever handles on double doors.	
/ dditorium 112	Provide lever handle on door to backstage.	
	Provide access to the stage 36" AFF. Provide a	
	lift inside backstage door beside stairs.	
Life Skills	Provide lever handles on door.	
Classroom 6	Trovide level flandles off door.	
Indian Education	Provide lever handles on door.	
Project 3	Trovide level flandles off door.	
Multipurpose 115	Provide lever handles on doors.	
Teachers	Provide lever handles on doors.	
Workroom 106	Trovide level flandles off doors.	
Teachers	Provide lever handles on doors.	
Copy/Lounge 109	Trovide level flandles off doors.	
Art 13	Provide lever hardware at exterior door	
7410 13	connecting to path to public way, and provide	
	a vision glass relight in the door.	
	a vision glass religite in the door.	
		A STATE OF THE STA
1. 1 4 4 20	Durith to select the selection of the se	
Ind Art 20	Provide lever hardware at exterior door	
	connecting to public way, and provide a vision	
	glass relight in the door. Provide a 32" wide	
	clear, striped path through the room to access	
	through to stair and classroom 21.	
Classrooms	Provide lever handles on doors with knobs	
	(approximately 10 doors.)	

## **Plumbing Elements**

Trumbing Liements		
Restroom 12,	If lift or elevator is not provided to connect	
Mens / Boys	main building to north wing by an accessible	
	route, renovate restroom to accessible single	
	use. Remove toilet stall, replace fixtures,	
	provide grab bars and relocate accessories.	
2 <sup>nd</sup> floor corridor	Provide an accessible drinking fountain.	
Library 129	Provide a sink at 34" with accessible controls.	
Office 121	Provide a sink at 34" with accessible controls.	
Restroom 20B	Provide occupancy indicator for unisex	
	restroom, and remove toilet partition.	
Ind Arts 20	Provide an accessible drinking fountain.	
Classrooms 8, 9, 21	Provide a lab sink at 34"AFF.	
2 <sup>nd</sup> Floor Girls &	These restrooms have been modified already to	
Boys Restrooms	comply with current ADA with the exception	
208, 209, 223,	of accessory placements. Lower accessories	
224	within complaint reach ranges.	
Home Economics, north basement	Provide a sink at 34 inches high.	

### **Communication Elements**

Communication Elements		
Restrooms 2, 3,	Provide visual fire alarm strobes if not already	
208 and 209, 223	installed.	
& 224		
Auditorium 112 /	Provide assisted listening devices.	
213		
Classrooms?	Any need for assisted listening devices in	
	programs at this school?	
Signage	Provide ADA signs at upgraded restrooms on	
	2 <sup>nd</sup> floor.	
Signage	Two ADA spaces exist at the north parking lot.	
	Re-sign one of the spaces to be Van Accessible.	
Signage	Provide accessible signage at new accessible	
	restrooms and common spaces. If signage is	

provided at classrooms, provide accessible	
signage.	

Special Spaces, Built-in Elements & Recreational Facilities

Boys Locker Room	Provide one bench in the locker room with	
113D		
1130	seat 20-inches deep and 42-inches long with	
	back support, ideally nearest to the showers.	
Girls Locker Room	Provide one bench in the locker room with	
113H	seat 20-inches deep and 42-inches long with	
	back support, ideally nearest to the showers.	
Library 129	Remodel counter to provide a lowered section.	
Office 121	Remodel counter to provide a lowered section.	
Home Economics,	Provide a work counter 34 inches high	
north basement	adjacent to the accessible sink.	

### Field Notes:

- 1. 2<sup>nd</sup> Floor restrooms 208, 223, 209 and 224 already had ADA upgrades implemented.
- 2. 1<sup>st</sup> Floor mens restroom 12 is being used as mens/boys.
- 3. 1st Floor womens restroom 13 already had ADA upgrades implemented.
- 4. 1<sup>st</sup> Floor Boys accessible restroom 7A is being used as a Life Skills Nursing room. Signage on door directs boys to restroom 12.



- 5. 1<sup>st</sup> Floor Girls accessible restroom 8A already had ADA upgrades implemented.
- 6. Basement Restroom 20A is being used as a unisex restroom, but lacks a privacy indicator.
- 7. Basement Restroom 20B is being used for storage, and plumbing fixtures appear to have been removed.