

# PORTLAND PUBLIC SCHOOLS – FACILITY ADA ASSESSMENT

Sacajawea Head Start                      K-5  
August 31, 2009

## Site Accessibility

Parking	There is (1) existing accessible on-site parking space marked and striped. No pathway marked from parking spaces to north west entry.
Exterior South Entry Ramp from	Verify if existing slight ramp with from sidewalk on NE Wygant is accessible, and provide accessible ramp if needed. If within PPS tolerance upgrade to double handrail (approximately 30 lf of ramp.)

## Accessible Route & Features

Main South East Entry	Replace (1) pair of 2'-6" doors with 3-0/2-0 unequal pair doors or 3-0 door with fixed sidelite or panel that meets accessible entry compliance. Provide lever door hardware.
North West Entry	Replace (1) pair of 2'-6" doors with 3-0/2-0 unequal pair doors or 3-0 door with fixed sidelite or panel that meets accessible entry compliance. Verify signage to entry is legible. Provide lever door hardware.
North East Playground Entry	Verify (1) pair of entry doors has minimum 32-inch single door clearances. Replace (1) pair of doors with (1) 3-0 and an unequal pair doors or 3-0 door with fixed sidelite or panel that meets accessible entry compliance. Provide lever door hardware.
Interior Ramp	Verify slope of interior ramp at N/S corridor near Room 100, and if greater than 1:20 slope, then provide double height handrails or install on each side conforming to children and adult handrail heights (approximately 12 lf of rail.)
Office	Verify entry door has a minimum 32-inch swing requirement and compliant accessible hardware.
Multi-purpose Room (RM 113)	Verify (1) pair of entry doors has minimum 32-inch single door clearances. Replace (1) pair of doors with (1) 3-0 and an unequal pair doors or 3-0 door with fixed sidelite or panel that meets accessible entry compliance.
Res. Center (RM109)	Verify door has minimum 32-inch single door clearances or replace door with 3-0 that meets accessible entry compliance.
Classroom 101	Verify door to corridor and door to play yard has minimum 32-inch single door clearances or replace doors with 3-0 that meets accessible entry compliance.
Classroom 108	Verify door has minimum 32-inch single door clearances or replace door with 3-0 that meets accessible entry compliance.
Classroom doors	Provide all classrooms with lever handle hardware. (7) classrooms.

## Plumbing Elements

Main Floor Boys	Provide accessible toilet stall, clearances, lavatory and accessories within reach ranges. Verify or replace entry/exit doors for compliant width and clearances.
Main Floor Girls	Provide accessible toilet stall, clearances, lavatory and accessories within reach ranges. Verify or replace entry/exit doors for compliant width and clearances.
Main Floor Unisex	Provide accessible toilet stall, clearances, lavatory and accessories within



	reach ranges. Verify or replace entry/exit doors for compliant width and clearances.
Drinking Fountain	Provide drinking fountain that complies with accessibility standards.
Office	If there is a sink in the main office or faculty space, provide a sink at 34 inches high.

Communication Elements

Interior Signage	Provide interior signage at accessible restrooms and common spaces. If signage is provided at classrooms, provide accessible signage.
North Entry	If the north entry door is locked during business hours, provide a two-way audio/visual communication device from the door to the office.

Special Spaces, Built-in Elements & Recreational Facilities

Serving	Verify that the serving line height and width are accessible.
Play Surfaces	There are (2) soft play areas at the outside play areas. Verify and test existing play structure safety surfacing at these areas. Mulch/ground cover must be solid enough to allow wheelchair access at one play area.
Play Structure	Verify that the existing play structure is accessible, and modify if needed.

